UNCLASSIFIED

AD NUMBER AD501574 CLASSIFICATION CHANGES TO: UNCLASSIFIED FROM: CONFIDENTIAL LIMITATION CHANGES

TO:

Approved for public release; distribution is unlimited. Document partially illegible.

FROM:

Distribution authorized to U.S. Gov't. agencies and their contractors;

Administrative/Operational Use; 14 FEB 1969. Other requests shall be referred to Assistant Chief of Staff for Force Development, Army Department, Washington, DC 20310. Document partially illegible.

AUTHORITY

30 Apr 1981, DoDD 5200.10; AGO D/A, ltr 29 Apr 1980

GENERAL DECLASSIFICATION SCHEDULE

IN ACCORDANCE WITH BDD 5200.1-R & EXECUTIVE ORDER 11652

THIS DOCUMENT IS:

BY
Defense Documentation Center
Defense Supply Agency
Cameron Station
Alaxandria, Virginia 22314

THIS REPORT HAS BEEN DELIMITED AND CLEARED FOR PUBLIC RELEASE UNDER DOD DIRECTIVE 5200.20 AND NO RESTRICTIONS ARE IMPOSED UPON ITS USE AND DISCLOSURE.

DISTRIBUTION STATEMENT A

APPROVED FOR PUBLIC RELEASE;
DISTRIBUTION UNLIMITED.

SECURITY MARKING


The classified or limited status of this report applies to each page, unless otherwise marked.

Separate page printouts MUST be marked accordingly.

THIS DOCUMENT CONTAINS INFORMATION AFFECTING THE NATIONAL DEFENSE OF THE UNITED STATES WITHIN THE MEANING OF THE ESPIONAGE LAWS, TITLE 18, U.S.C., SECTIONS 793 AND 794. THE TRANSMISSION OR THE REVELATION OF ITS CONTENTS IN ANY MANNER TO AN UNAUTHORIZED PERSON IS PROHIBITED BY LAW.

NOTICE: When government or other drawings, specifications or other data are used for any purpose other than in connection with a definitely related government procurement operation, the U.S. Government thereby incurs no responsibility, nor any obligation whatsoever; and the fact that the Government may have formulated, furnished, or in any way supplied the said drawings, specifications, or other data is not to be regarded by implication or otherwise as in any manner licensing the holder or any other person or corporation, or conveying any rights or permission to manufacture, use or sell any patented invention that may in any way be related thereto.

DISCLAIMER NOTICE

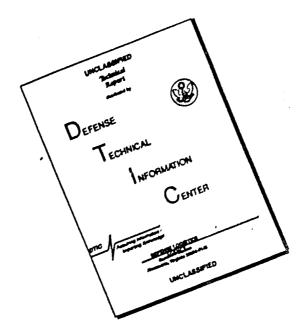

THIS DOCUMENT IS BEST QUALITY AVAILABLE. THE COPY FURNISHED TO DTIC CONTAINED A SIGNIFICANT NUMBER OF PAGES WHICH DO NOT REPRODUCE LEGIBLY.

ND 501574

"This document centains information afforting the National Defense of the United States within the securing of the Espionage Laws, Title, 13, 4, 8, 6, for item 795 and 794. Its transmission or the received of its accepts in any manner to an upanthe sind process of 151 at the law."

- 1. Subject report is forwarded for review and evaluation in accordance with paragraph 5b, AR 525-15. Evaluations and corrective actions should be reported to ACSFOR OT UT, Operational Reports Branch, within 90 days of receipt of covering letter.
- 2. Information contained in this report is provided to insure appropriate benefits in the future from lessons learned during current operations and may be adapted for use in developing training material.

BY ORDER OF THE SECRETARY OF THE ARMY:

l Incl

KENNETH G. WICKHAM
Major General, USA

The Adjutant General

MAY 1 9 1969

OF

mel (1003 650)

Regraded unclassified when separated from classified inclosure.

DEPARTMENT OF THE ARMY HEADQUARTERS, 7TH ARMORED SQUADRON, 1ST AIR CAVALRY APO SAM TRANCISCO 96357

AVH!-JC

14 Pebruary 1969

For Period Ending 31 January 1969 (RCS CEFOR-65) (RL) (UIC: WG26 AA)

I. (C) Section I, Operations: Significant Activities.

A. There were no changes or additions to the unit ression.

B. Organization:			
ASSIGNED WILTS	M/R VICINITY	LOC_	APO
7th Squm, 1st Air Cav	WGZ6 AA	Vinh Long	96357
Headquarters Troop	WGZ6 TO	Vinh Long	96357
A Troop (Air)	WGZ6 AO	Vinh Long	963 57
D Troop (Air)	NGZ6 BO	Vinh Long	96357
C Troop (Mr)	WGZ6 CO	Vinh Long	96357
D Troop (Ground)	1.026 DO	Vinh Long	96357
DETACHED UNITES			
ЮТ	•		
ATTACHED UNITS/SECTIONS	N/R AICHAILA	100	APO
3rd Signal Detachment	NCG9 AA	Vinh long	96357
811th Signal Detachment	IDXZ AA	Vinh Long	96357
S19th Signal Detachment	WDXJ AA	Vinh Long	96357
370th TC Detachment	WEB3 TO	Vinh Long	96357
371st TC Detachment	Web4 1A	Vinh Long	96357
574th TC Detachment	WEEL AA	Vinh Long	96357

FOR CTUT

691178

Inclosure

CONFIDENTIAL

DOWNGRADED AT 3 YEAR INTERVALS-DECLASSIFIED AFTER 12 YEARS. DOD DIR 5290.10

C. COMMAND:

The following are personnel occupying major command and staff positions:

(a) LTC George R. Crook

Squadron Commander

(b) Naj Harold L. Johnson

Squadron Executive Commander

(c) Cpt Raymond A. Fields

Adjutant

(d) Cpt Robert K. White

32

(e) Maj Noman M. Bissoll

33

(f) Maj William J. Ambangor

34

(g) LLT Gary G. Cashion

Signal Officer

(h) Opt John F. Kunishi

Might Surgeon

(1) Opt Charles K. Holianus

Safaty Officer

(j) Maj James H. Weaver

Maintenance Officer

(b) Opt Stanley S. Fracker III

CO, Haadquarters Troop

(A) Maj Phillip G. Sheaffer

CO, Troop A

(n) Maj David E. Thompson

CO, Troop B

(n) Maj David V. Leins Jr.

00, Troop &

(o) Cpt Ronald D. Grandel

CO, Troop D

D. UNIT STEELIGTE AS OF 31 JANUARY 1969:

l. Hillitary:

	OFF		WO		EN	ļ!	TOTAL	
UNIT	AULT.	0/н	AU	<u>0/1</u>	AUTH	U/H	AUTH	0/11
HH	23 .	23	7	6	181	1 61	211	190
A	1841	19+1	30+2	22+2	121+59	8 7:4 3	169 %2	130+51
B	1641	2011	30+2	17+2	121-159	89 16 0	169+62	1.26+63
C	16-11	3781	30+2	13+2	121+59	76+51	16 9÷62	111+54
D	5	5	0	0	127	122	132	127
7/1.	82+3	7415	97+6	63+6	671+177	537÷15 9	050+186	654+163

2

Tripsore

2. CIVILIANS:

Sub -units		Keps O/H	us c	IV IV	VN C	IV O/H		nat H\0 H	CONT	I 0/II	
HULL	0 .	2	C	0	7	7	0	0	0	0	
A	0.	0	0	0	7	7	0	0	0.	0	
B	0	0	0	0	0	. 0	0	0	0	0	
C	0	0	0	0	7	7 .	0	0	0	0	
D	0	0	0	0	7	_7	0	_0	0	0	
7/1 ACS	0	2	0	0	28	28	0	0	0	0	

3. Overall assigned/attached strength during the reporting period as follows:

DATE	OPPRIORI	WARRANT OFFICER	PAINISPED NEW
30 Nov 68	79	. 83	755
31 Dec 68	85	81	651
31 Jan 69	87	61	696

E. AIRCRAFT AUTHORIZED/ON HAND

					•			
SUPORD UHIC	U AUT	H1H I 0/II	AHI	G 0/19	OTIE AULT		AUTH	0/1. 0/1.
THE S	7	5	0	0	0	0	7	5
Δ .	ន	8	9	· 9	10	10 -	27	27
B	ន	8	9	9	10	9	27	26
C	ន	ទ	9	9	10	9	27	26

7/1 ACS	31	29	27	27	30	28	ଟ୍ର	84

3

r. Cuentarny totals:

1. SUB	MISULTS:	*	BA	. 12	TA		STR	UCTUR	e sam	PANS	BIN	KERS	ATR	CRAFT
BIIT	SORTERS		P053	_	POSS	POW		DEST		DIST		DEST		DESI
HMT	1642					,							1	
*	10458	275	69	92	15	66	14	379	2 🖰	224	23	96	18	1
B	9063	245	25	55	12	52	4	199	12	271	1	5 9	19	4
C.	8736	261	11	91	1.	46	9	272	20`	520	1	34	13	2
D				4		هـ.	-							
TOT	29899	781	105	292	23	160	27	850	34	1115	25	189	51	7

AIRCRAFT BY TYPE

DEST 4 DAM 23 OH6A DEST 2 DAM 12 OHLH DEST 1 DAM 11 AHLG

TOTAL 50

2. Losses: PERIOD 1 November thru 31 January

DMOS	XXA	MA	E WIR SO TO DUTY
11210		2	2
11.320		2	2
סומנו		2	2
11D20		. 2	2
11D40		ે 5	5
11:110	1	2 5 1 2	5 1
11 320		2	2
1204		1	1
71320		1	1
062B	1	3	8
064B		1	1 6
61204		6	6
62127		1	1
67ALF	2		
671:20		3	3
67U20		2	2
TOTAL	4	39	39

G. PERSONNEL

- 1. During the reporting period emphasis was placed on the infusion program with officers/warrant officers and emlisted men. The current officer/warrant officer infusion continues through January and is scheduled to be completed during February 1969. This headquarters does not anticipate further serious rotation humps until January 1970, when presently assigned officer rotations will exceed 40%. Programing is currently underway to correct this problem area.
- 2. On 5 November 1968, LTC George Crook assumed command from LTC Robert W. Mills. The change of command ceremony, conducted at Winh Long Airfield, was attended by the IV CTZ SA, Major General Echardt and the 1st Aviation Brigade Commander, Major General Robert R. Williams.
- 3. During the 1st Week in Docamber the Squadron prepared to receive Troop B, 7/1 ACS who returned to the Squadron from Di. As. Republic of Vietnem where they had been attached to the 3rd Armoned Squadron, 17th Air Cavalry since May 1962. On 8 December, Troop B returned to the 7th Armored Squadron, 1st Air Cavalry. A great deal of co-ordination and liaison was conducted in order to prepare for their arrival. On 7 December 1968, a correctly took place on the South Ramp for the arrival of Troop B with Major General Echardt attending along with the 9th US Infantry Division Bend.
 - 4. With stabilization of the Squadron in permanent facilities, additional time has been available to establish and develop administrative operating procedures and management policies. Daily emphasis has been placed in this area to insure naxious and proper utilization of all Squadron personnel consistent with current directives and mission requirements.
 - 5. This headquarters has experienced considerable difficulty during this reporting parised in obtaining assignment instructions for lower grade enlisted personnel (grade 86 and below). This not only created an additional burden on administrative sections, but created a low morale factor for the affected individuals, since they were normally unaware of their CONUS assignment until after arrival at their leave address.
 - 6. The Squadron was administered its first USARV AGI during the period of 27-31 January 1969. The Squadron received a satisfactory exit briefing on 31 January 1969.
 - 7. Military justice activities for the period 1 Movember 1959 to 31 January 1959:

ACTION	SCIFFDULES	CCMPLETED	PRIDING
Special Courts-Mertial:	2	2	ŋ
Surrary Courts-Martial:	1	ï	O
212 Elimination Action:	3	3	0
Squadron Level Article 15's:	Ō	Ô	0

8. The Squedron continues to utilize 100% of its allocations for Australia and Hammin; approximately 80% of the allocations for other RAR centers are presently being filled.

5

9. During the reporting period, awards and decorations have been recommended and approved as follows:

AWD	RECOM	APP	DEGRADE/UPCLADE	DISAPP	PENDING
SS	4	3			1
IM	ġ				3
DFC	12	8			Ã
S .	1		•		ĩ
BSI TIVI	1		1		_
A'n' V''	9	8			1
BSM	39	10	5		23
Al!	194	117			77
ARCOL!! VI	5	3	2		2
ARCOM	30	ıí	1		18
PH	8	7	_	1	20
CIB	31.	1.2		2	17
Cert Ach	9	5	1	~	3

H. OPERATIONS:

- 1. During the reporting period the Squadron continued OPERATION BLACKBANK in the 44th STZ to interdict and harass enemy movement across the Cambodian border into the Delta. Primarily, two troops were used in this role on a daily basis. On occasion, one troop would be diverted to work in general support of one of the Division operations to perform a visual reconnaissance of the operational area prior to insertions, bomb damage assessments, or to screen the flanks of the Division operational area.
- 2. During the first week in December 1968, Troop B joined the Squadron at Vinh Long after being attached to the 3rd Armored Squadron, 17th Air Cavalry since May 1968. The necessary co-ordination and preparations to incorporate the additional Air Cavalry Troop in the Delta were conducted and completed in minimum time. Troop B closed Vinh Long on the 8 th of December and commenced operations in IV CTZ on the 9th of December. In order that terrain familiarization and operational orientation were incorporated immediately, the Squadron infused key personnel for a temporary period to fly with Troop B to assist them in the new environment and operational characteristics of the Delta.
- 3. The arrival of Troop B enabled the Squadron to continue operating with two Air Casalry Troops along the border and still continue operations in support of the Divisions.
- 4. During the month of December, great emphasis was placed on night operations to further interdict possible enemy movement across the Cambodian border. Various methods and concepts were employed by the Blackhawks dening the night operations in the 44th STZ. One Air Cavalry Troop conducted night operations while the other continued daylight operations giving the border zone 24 hour coverage.
- 5. During these operations, the Air Cavalry Troops employed various lighting devices to pick up targets and movement along the canals and heavily traveled infiltration routes. The use of flares, deployed at timed intervals to illuminate large areas, proved valuable enabling the Air Cavalry Troop to conduct a VR.

with organic assets. The use of a Xenen light or the C-123 search light cluster in the door of the load circust proved very successful when conducting a VR of a canal line or specific trail. This enabled the scout or gum ship to fly just outside the boam and engage detected targets.

- 6. Troop D conducted operations in the vicinity of "ui Coto (WS005520) providing security for a fire support base during the month of Movember. While providing security, 106RR crows were deployed on armed personnel carriers and air boats to maneuver over terrain, impassable to whooled vehicles, to a position where the 106NR crews could successfully fire directly into the neuths of VC caves on the mountain. (See Incl I)
- 7. During December and January, Troop D remained in the vicinity of Chi Lang, (W3020550), providing perimeter security for the airfield. One platoon remained with a fire support base for security in the vicinity of Tri Ton, (WS005520). All resupply of armunition, rations and water was provided by Squadron aircraft on a daily hasis.
- C. On 31 December 1968, Troop B brought a memorable new year to the Squadron when they found and repatriated Major James H Rowe from the U High Forest, (VR953490) after he had been held captive by the VC for 5 years. (See Incl 2).
- 9. During an operation with the 21st ARVW Division on 4 January 1969, Troop B proved the capability of the AN-16 for use as a med-evac aircraft during an operation SW of Vi Thanh, (MR530620). While conducting a VR, 2 Scout aircraft received heavy fire foreing both aircraft to go down, one crashing and burning the state of the st irmact. The two MI-10 gun ships supporting the VR immediately jettisoned rocket pods and landed in the two separate locations of the downed aircraft. The wounded crews of the Scout aircraft were placed on the anne bay down and flown for 30 minutes to the medical evacuation hospital at Binh Thuy on the two gunships. (See Inol 3).
- 10. During OPERATION II ACKHAMK on 14 January 1969, Troop A and Troop B simultaneously made contact with 2 VC Battaliens infiltrating down through the 44th STZ from Cambodia. Both troops made contact at approximately the same time in areas about 30 Milomoters apart. Troop A discovered numerous sampans and personnel in the vicinity of coordinates (NETACE20) resulting in a large ormunition and equipment capture as well as the first 107ML with 55 rounds found in the IV CTZ. Troop B, working to the east, vicinity (X3050550), node contact while inserting ground troops into a possible energy base comp. The contact leated throughout the afternoon resulting in 75 VC MBA and 10 possible VC MBA. The total results for the Sausdan on that day some an follows: results for the Squadron on that day were as follows:

70SS 1.... POVI 163 20

Equipment Captured:

45 - AK 47

170 - Henr Gronedos 5 - B40 Rochet Launchors

3 - Hoavy Linchine Guns

20 - Cases of B40 Rockets

3 - Cases of Gas liasks 1 - 107Mil Rocket Leuncher

56 - 107nm Rockets

- 11. A chert of curalative, results for the reporting period is attached as incl. 4.
- 12. The breckdown of days the units were engaged by type activity during the reporting period is as follows:

I. TRAINING:

- 1. Due to the great increase of new personnel to the Squadron during this reporting period, a great deal of emphasis and co-ordination went into in-country training at Squadron level.
- 2. All new pilots received a Squadron briefing conducted by the S-3 section on policies, safety, indiscriminate firing, rules of engagement and border restrictions prior to commencing their flight training in the respective troops. Classes were conducted weekly.
- 3. All other personnel arriving in the Squadron were given a 5 day incountry crientation by Troop D personnel conducted at Vieh Long Theater. Personnel were taught all the basic and required subjects listed in USARV 350-1, concluding with a combat ambush patrol in Vinh Long Province. Classos were conducted bi-monthly during the period to insure that all new personnel received the training.

J. INTELLIGRACE:

- 1. During the past reporting period, meximum emphasis was placed on the gathering of effective and timely intelligence data. Liaison visits with the various American and Vietnamese units around Vinh Long has helped improve the S-2 collection of intelligence data, thus enhancing Air Cavalry operations.
- 2. The centimued use of the National Pelice Force has proven effective in gathering intelligence data during sweeps around the perimeter of the Lirfield. It has also contributed appreciably to the improvement of Vietnamese and American relationships.
- 3. During the period 1 November 1960 thru 31 Jenuary 1969, all ambush activity was curtailed. This was due to the departure of Troop D, the ground Cav Troop, on an extended operation at Chi Lang (WSO20550). It was also due to the emphasis put on the pacification program underway in the towns and harlots in the Vink Long Province.
- 4. The S-2 scotion, in conjunction with the S-3 section, also undertook the project of constructing a Squadron Training Museum. The museum was built in replice of a VC but and contains various items of equipment and meanons often used by the VC. This has proven most effective in the crientation and in-country training given all new secut pilots. It gives the OHSA pilot a first hand look at some of the equipment and meanons he will see in the operational area.
 - 5. In January 1969, the Squadron was given the overall responsibility for

the defense of the mirfls. Parameter. The 5-2 section, working in conjunction with the S3 section, took ever the responsibility and completely reorganized the defense system. VLALA Defense Plan 1-50 (U) assigned perineter areas of responsibility to various toward units on the Airflold. Construction of new bunker/tower complexes was completed and units are presently improving their barriers and communications. All activities pertaining to the airflold defense such as Fire Fly, Here Reotch and Mod-Evac are now centrally located and controlled by the Squadron. Defeliation of the area just outside the perimeter surrounding the mirfield has been completed to improve observation and fields of fire.

K. SAFETY:

- 1. During the reporting period there were three accidents involving Equadron aircraft. A brief account of these accidents follows:
- a. Troop 4, 0H64, 1 Dec 63. This aircraft had tail rotor failure and possible partial power loss. The aircraft was autorotated and touched down hard and tail low. The main rotor severed the tail boom.
- b. Troop A, MilG, 13 Jan 59. While engaged in a training flight autorotation, the aircraft touched down in a left year. The pilot overcorrected after touchdown and the aircraft yeared to the right, skidding off the black top. The left skid collapsed, and the rain roter struck the ground breaking the most six inches below the main roter head.
- c. Troop L, OHML, N7 Jan 69. During a training flight the pilot was executing an autorotation. The aircraft hit tail low and the main rotor flexed cutting off the tail boom.
 - 2. Safety Record (Nov 68 to 31 Jan 69)

UHT	TOTAL HOURS FLOW!	ACCIDITIES	RELE
HHT	3.244	0	0
L Trp	8972	3	43.0%
B Try	5346	0	0
C Try	5868	0	0
7/1 ACS	19430	3	15.4%

- 3. Command exphasis continues to be placed on the possibility of FOD. The ramp and revetment areas are maintained in a high state of police and a class has been held on the cause and provention of FOD for all pilots and crew members. The Squadron Maintonance Officer and Factory Technical Representative conducted the class.
- 4. There has been a very large turnover of personnel within the Squadron during the neath of January and the majority of our pilots are now and inexperienced. However, due to command emphasis and the individual attitudes displayed in the Squadron it is expected that our accident rate will remain at a low level.
 - L. COMMUNICATIONS:
 - 1. In Movembor, the 7/1 LCS Communications Center installed a land line

secure teletype system. This system replaced the ratio teletype system that was set up originally. This system along with the KM-7 gives the communications center a secure and here officient message releasing and receiving capability. The circuit output has improved transmitually since this system was installed. The TT-76 and TT-98 were hand receipted from the area communications center.

- 2. The 52nd Sig.Det.began installing a 200 pair cable during the last part of Movember. This cable will replace all connercial phone lines that are on the original 100 pair cable. The telephone system in the 7/1 LCS has been a constant problem with the deterioration of the old 100 pair cable. This new beavy duty cable will greatly improve the telephone communications in the 7/1 LCS.
- 3. When the last OKLL was written, it was stated that Squadron secure communications had been improved and expended by the receipt of additional TSEC/KY-28's. Additional KY-28's have been issued to the Squadron and more will be issued in the future. Our goal, of each aircraft having a voice-secure capability, should be fulfilled in the next quarter. The TSEC/KY-26's which the Troops have in their present aircraft and the KY-28's in their TCC's are keyed daily by the Troop communications personnel. The keying equipment KYK-12 and KYK-28 has been hand receipted to the troops along with daily extracts of the keylists. This alleviates the Squadron communications section from keying all the circraft that have KY-28's installed.
- 4. During the third week of Jamuery, Squadron communications closed their accounts with the 51st Maint. Co. (Ord) in Can The. Evacuation of signal repair items is now being handled by the 238th Maint Co. The 238th will evacuate the items to Binh Duc for repair. This helps the Squadron in that previously the item had to wait until transportation became available to Can The. Some equipment is still being sort to the 2nd Maint.Bn. Vung Tau. Their outstanding support has kept the ratio of deadline equipment down.
- 5. On the 20th of January, the Squedron and Troop communications nots were nonitored by the 101st Redic Research Co (ASA) by request of the Squadron Communications Officer. The tactical radio and telephone systems were closely monitore for a period of two weeks. The team found very few security violations during this period, Randon frequencies were checked every day and all phone calls through the switchboard were conitored. The team did recommend more use of the KAC numerical codes, which is being implemented at this time.

M. LOGISTICS:

- 1. During the reporting period, the S4 continued to render logistical support to the 7/1 ACS. In the beginning of November, plans were used to move Troop B from Di An to our location in Vinh Long. The S4 was responsible for construction of billets, latrings, showers, and office facilities prior to their arrival. Construction was also started on aircraft revetments and paving of the south ramp to handle the increased aircraft. On 5 December 1968, Wab Tec buildings for Troop B were completed.
- 2. On 11 December 1968, Troop D commenced an operation for the 44th STZ in the vicinity of Chi Lang (MSO20650) lasting throughout the reporting period. The Squadron was responsible for daily resupply of all rations, arminition and water during the period. This necossitated 3 sorties a day to fulfill the new counit-

- 3. During the month of December, several Lisison trips were conducted by the S4 to our direct and general support units to hand carry requisitions for combat essential items and to maintain a harmonious relationship with these units.
- 4. In late December, the \$4 made arrangements with the 506th Depot in Long Binh to exchange all of our M-16 rifles for new weapons with chrone chambers. On 30 December, 225 of the new weapons were picked up and issued to the troops. This required extensive coordination within the Squadron in that many of the troops were in field locations and aircraft were required to make deliveries. As the new weapons were picked up from Long Binh they were issued to the Troops. On 23 January 1959, the weapons exchange was completed for the entire Squadron.
- 5. In January, this Squadron assumed the responsibility for the entire defense of the cirfield perimeter. Coordination and plans were made with the 164th CAG to increase the amount of weapons and armunition allocated for the perimeter. The primary problem was the fact that many of the units at Vinh Long did not have the weapons and equipment required assigned as TOAE. Requirements have been submitted to the 164th CAG for the necessary equipment. Barrier material(concerting wire, sand bags and lumber) have been obtained or placed on requisition to strengthen the perimeter.
- 5. During the month of January, coordination was made with the 53rd Gp in Vung Tau to receive assistance and recommendations for the Vinh Long Ammunition Supply Point. Representatives from the 148th Ordnance Co. nade several visits to the supply point and provided additional personnel to supervise procedures in the issue, handling, and storage of ammunition. As a result of their assistance the ammunition storage area is under construction and is expected to be complete by the end of Fobruary. This will enable the Ammunition Supply Point to maintain a larger stock of ammunition within a more secure environment, and will ensure more efficient support to the Squadron as well as the installation.

- II (0) Section II, Lessons Learned: Commander's Observations, Evaluations, and Recommendations.
 - A. Personnel: None
 - B. Operations:
 - 1. Joint Operations with ARVN Units:
- (a) Observation: Indigenous units are not always able to provide a reserve or back up force for Air Cavalry Operations.
- (b) Evaluation: Without adequate reserves it is highly undesirable to deploy the Infantry platoon organic to the Air Cavalry Troop. It is also undesirable to conduct normal cavalry operations with insufficient reserves to provide security for downed aircraft and crows.
- (c) Recommendations: That commanders effect coordination with units having operational control of their Air Cavalry Troop to insure that reserves are available and that a thorough mutual understanding is reached as to conduct of missions. This co-ordination should be made through ARVN channels as well as U.S. Advisory channels and a clear understanding reached prior to launching the mission. When the supported unit is not able to provide reserves, the tactical employment of the aircraft should be modified to minimize the risk of losing an aircraft to hostile fire.
- (d) Command Action: The Troop Commander or his representative, prior to each mission, co-ordinates with the Senior Advisor and Counterpart to establish use of reservo forces. Prior to departing for the AO, the mission commander physically checks the presence and combat readiness of the reaction force at the staging area.
 - 2. Aircraft Recovery:
- (a) Observation: When an aircraft is forced down in the area of operations, the need for immediate recovery is importative, if the primary mission is not to be detracted from.
- (b) Evaluation: On many occasions it has taken the recovery aircraft as much as 1.5 to 5.0 hours to extract a downed aircraft. Air and ground troop assets are tied up for extended periods of time.
- (c) Recommendations: That recovery aircraft (CH-47) with rigging crews be staged at Soc Trang and Vinh Long on a daily basis for immediate recovery of aircraft stationed at those locations.
- (d) Command Action: The feasibility of decentralisation of recovery aircraft in the Delta is presently being analysed. The recovery officer

12

from the 611th Meintenance Company has been consulted concorning this problem.

- 3. Night Operations:
- (a) Observation: The use of xenon searchlights for illumination during night missions has proven ineffective.
- (b) Evaluation: The xenon searchlight is excellent for illumination of targets at great distances. When used on an aircraft, even on wide beam, the light beam is too narrow for use while in the air.
- (c) Recommondation: That the illumination aircraft discontinue the use of the zenon searchlight and utilize a C-123 searchlight cluster. This system has been used effectively within the Squadron, however a more effective wider coverage system is still needed.
- (d) Command Action: The xenon searchlights in the Squadron have been replaced with the C-123 searchlight clusters and reinforced with aircraft flores.
 - C. Training:
 - 1. In-country Training:
- (a) Observation: New in-country personnel assigned to the 7/1 ACS are not completing the in-country training within 7 days after arrival in country, as required by USARV 350-1 regulation.
- (b) Evaluation: Personnel assigned to the unit normally complete their in-processing to include personnel records, finance records, signing for equipment and troop orientation approximately 3 to 4 days after being assigned to the Squadron. The average reporting time to the Squadron from arrival date in country has been 4 to 5 days. Training cannot be conducted or scheduled often enough to meet all requirements. Additionally, Squadron does not have readily available range facilities or personnel to conduct in-country training as frequently as required.
- (c) Recommendation: An in-country shhool be established and conducted for personnel assigned to non-divisional units arriving in-country at or near the replacement conter, where personnel can receive the required training prior to assignment. This would enable the personnel to meet the training requirements, receive good training at facilities that are adequate and allow, in some cases, a closer screening of records and personnel for assignment to units while training is being conducted.
- (d) Command Action: The Squadron is conducting in-country training with facilities at Vinh Long. Training is being conducted bi-monthly and as required as soon as possible after replacements arrive in the Squadron.
 - D. Intelligence:
 - 1. POW Intolligence:

- (a) Observation: Information acquired from POWs by immediate interrogation enhances the successful completion or exploitation of the Cavalry mission when operating with ANVII Divisions.
- (b) Evaluations When the Cavalry troops bring POWs or documents to the Division headquarters or senior unit which they are supporting, it is difficult to get information passed back to the troop commander on the results of POW interrogation. In almost all cases, the troop is returning to work in the same area and such information would greatly enhance mission results.
- (c) Recommendation: All units requesting Air Cavalry troops should immediately attempt to pass on any information gained through POW's or documents. Emphasis should be placed on interrogating POW's upon their capture and relaying this information to the mission commander by the most expeditious means.
- (d) Command Action: Squadron has sent personnel to respective Division Headquarters for informal briofings where this point has been stressed. Additionally, mission leaders are making the specific point of requesting any information when a FOW or document is turned into the Division TOC.
 - E. Logistics:
 - 1. Shortage of Propane Gas:
- (a) Observation: Recent increases in contonement ness hall equipment has increased the requirement for bottled propone resupply to a daily basis.
- (b) Evaluation: During the reporting period many new items of garrison type equipment such as coffee ums, hot and cold serving lines and mixing machines have been issued and installed requiring zero propone than is presently available at Vinh long.
- (c) Recommendations: That the Squadron have bulk propone tanks installed near the mess hall and that resupply of propone be on a regularly scheduled basis.
- (d) Cormand Action: The Squadron S-4 has coordinated with the USARV POL Officer concerning this problem. The USARV POL Officer is assisting in obtaining the tanks and is arranging for scheduled delivery of propone gas.
 - 2. Turn-in of Unservicable Equipment:
- (a) Observation: Property disposal facilities are not in close proximity to Vinh Long.
- (b) Evaluation: Equipment Technically inspected by the 238th Maintenance Company and declared unserviceable must be turned in to a property disposal facility. The nearest facility of this type is located in Vung Tau. Disposal of unserviceable equipment requires aircraft to be utilized for other than operational missions. At present the 238th Maintenance Company has no facility for accepting or storage of those items pending availability

of cheaper transportation, i.o. water craft. There is no adequate read network from Vinh Long to Vung Tau.

- (c) Recommendations: That a property disposal facility be centrally located at Can The which would be easily accessible by road to units located at Sec Trang and Vinh Long. Also recommend that the 236th Maintenance Contact Team at Vinh Long accept unserviceable material required to go to the property disposal facility at Ving Tau and that they be given the responsibility to evacuate this equipment.
- (d) Command Action: Arrangements have been made with the 238th Maintenance Contact Team at Vinh Long to accept unserviceable equipment and to evacuate this equipment to Vurg Tau.
 - 4. Command and Control Console, AN/ASC-11:
- (a) Observation: The 7/1 ACS is authorized three command and control consoles, AN/ASC-11, according to MMCE 17-95T, dated August 1968. The Squadron has one AN/ASC-10 in the Squadron Commander's aircraft.
- (b) Evaluation: The Squadron Commander's aircraft is used as the command control aircraft in the area of operation. Because the Squadron operates in three different AO's on any given day, one console equipped aircraft is inadequate.
- (c) Recommendation: Request the 7/1 ACS be issued the three AN/ASC-11's authorized by the 1808 to ensure that the Squadron command and control aircraft are equipped with the console.
- (d) Command Action: The three AM/ASC-11's have been on requisition since the 7/1 ACS was authorized the AM/ASC-11's, follow up action has been initiated with negative results.
 - 5. Support Maintenance for the MX6707 Antonna Matching Unit:
- (a) Observation: MK6707 mounts are turned in to the 2nd Maintenance Battalion in Vung Tau for repair. The antenna matching unit cannot be repaired in-country and is therefore sent to Sacramento Army Depot for repair.
- (b) Evaluation: The MX6707 antenna matching units have not been returned since the first one went in several menths age. However, six antenna matching units were salvaged at the support maintenance unit and these items were dropped from our inventory. These matching units were put on requisition and received the latter part of this quarter. The new items were deploted immediately to replace imperable units on vehicles. The supply is at a critical state and none have been salvaged recently.
- (c) Recommendation: That a support unit be established in the Dolta to repair antenna matching units. If the antenna matching unit does have to go to Sacrumento Army Depot more units should be salvaged, allowing new units to be placed on requisition.

- (d) Command Action: The 7/1 ACS communications section is presently utilising the 23th Maintenance Company in Binh Duc for repair. If this unit can repair the MX6707 mount, the item will not have to be sent to Sacramento Army Depot.
 - F. Other:
 - 1. 4RC-54 Radios:
- (a) Observation: Avienic difficulties have been found in the ARC-54 radios.
- (b) Evaluation: Continuous operation of the FM radio has caused overheating and eventual malfunction in the transmitter. By limiting the transmission time and also any surge of power to the radio itself, the life of the radio could be extended.
- (c) Recommendation: Transmissions be limited to 30 seconds with a cooling interval prior to the next transmission. Prior to turning on the radics, inverter checks should be nade and the aircraft load meter should stabilize on 5 or loss.
- (d) Command Action: All pilots are thoroughly briefed on the radios operation and limits on radio transmissions. The load meter check prior to turning on aircraft radios has been included in the runup 50P.
 - 2. AH-1G FM Antonna:
- (a) Observation: The FM antenns on the AH-IG is positioned in the pylon enclosure behind the engine oil reservoir. An oil film and accompanying dust and dirt docreases the range and effectiveness of the FM radio.
- (b) Evaluation: Because of the close proximity of the entenna to the reservoir this problem must be checked after every flight.
- (c) Recommendation: That a sheet metal shield be placed between the reservoir and antenna or the antenna should be relocated.
- (d) Command Action: All pilots on their proflight and postflight inspections check the antenna for cleanliness. An EIR is being submitted on this problem.
 - 3. Switch, Pressure Sensing (OH6A):
- (a) Observation: After sitting for several hours an OHSA lost the prime to the engine fuel pump. This aircraft could easily be primed by removing the fuel line from the fuel spray nezzle (FSH 2849-929-9395) and netering the engine with the starter. Otherwise, operation was normal.
- (b) Evaluation: The entire fuel system was checked for loaks where air could enter the system cousing contamination. Finally the engine fuel pump was replaced along with a differential pressure switch (2007)-979-9187). This innediately solved the problem. Other instances have shown that this differential pressure switch has caused fuel pump cavitation. After

considerable consultation between maintenance personnel and engine technical representatives it is felt that loss of prime can be attributed to a feulty disphragm in the pressure switch.

- (c) Recommendation: When fuel pump cavitation or loss of prime occurs, which cannot be attributed to leaking fuel lines or fuel stoppage, the pressure switch (FSN 5930-979-9137) be replaced as the next step in trouble sheeting.
- (d) Command Action: The direct support TC Detachments for each troop have been thoroughly briefed on this problem. The pressure switch (FSN 5930-979-9187) is presently being stocked to neet replacement requirements.
 - 4. OHSA Main Rotor Blade Dampers (FSN 1615-922-8200)
- (a) Observation: After two to three hundred hours on the OH6A, lateral vibrations were experienced. These could be worked out by exercising the main rotor dampers; however, the lateral vibrations continued to reoccur and a new damper did not always solve the problem.
- (b) Evaluation: After considerable experimentation, it was found that by keeping a supply of dampers (FSN 1515-922-3200) the break torque on each damper could be marked in inch/pounds. Hernelly, when a damper problem arises, one or two of the dampers are near the maximum or minimum torque limits. By matching the four dampers which have a range spread of 20 inch/pounds or less, the lateral vibration is eliminated. Rough handling of blades when phasing also causes damage to the dampers.
- (c) Recommendations: When lateral vibrations are experienced on the OH5A, a set of 4 dampers should be matched with a range spread of less than 20 inch/pounds differential, with the average break torque between 255-285 inch/pounds. Only 2 dampers are authorized for stockage by TM 55-1520-214-35P; they should be declared a combat essential item with at least 4 each on hand at unit level. Also, if dampers which are removed are still within the range of 255-285 inch/pounds, they should be marked with torque values and restocked. Pilots and crew members should use caution when phasing blades.
- (d) Commend Action: All aviators and crew chiefs have been instructed to phase the blades with caution. The direct support TC Detachments and all maintenance officers have been furnished the above information. The Squadron has requested authority for additional stockage.
 - 5. OHSA Recovery:
- (a) Observation: Puring several OHSA recoveries, characteristics of instability have been found in different eigeraft configurations.
- (b) Evaluation: Experience has rovealed that the OHSA is very unstable while being evacuated when the crew and cargo doors are installed and the tail book is missing.

- (c) Recommendations: If the tail boom is missing, the crew and cargo doors should be removed and carried inside the recovery aircraft.
- (d) Command Action: All recovery teams in the Squadron have room instructed to comply with the above recommendations.

4 Incl

- After Action Report Mounted 106mm RR
- After Action Report 31 December 1968

After Action Report 4 January 1969

my Readpoint Captured or Destroy

GRORGE R. CROOK

LTC, Armor

Commending

AVBACE (14 Feb 69) 1st Ind

SUBJECT: Operational Report of 7th Armored Squadron, 1st Air Cavalry for Period Ending 31 January 1969 (200 CEFOR-65) (21) (U)

DA, E., 1640T AVIATION GROUP, ATO 96215, 22 February 1969

SEE DISTRIBUTION

- 1. (C) Section II, Ressons Rearned: Commander's Observations, Evaluations, and Recommendations.
 - a. Personnel: None
 - b. Operations:
- (1) Joint Operations with ANY Units: This Headquarters concurs with the recommondations and action taken.
- (2) Aircraft Recovery: Thore is not a shortage of recovery ships (UL-47) but rather a shortage of rigging material and rigging ships (UH1D). During the month of December, the 611th maintenance Company inventory of UM1D adreraft was reduced to one aircraft that was available for rigging. Frior to this, the 611th had two rigging ships, one at Soc Trang and one at Vinh hong. If this ship goes down for any reason, the immediate rigging capability for IV Corps is drastically curtailed. 154th Group then has to provide a ship to pick up the rigging crew. This is time consuming. Then Group is informed that the 611th ship is down, a ship is sent to the 611th for rigging assistance. To help alleviate this problem, the Group aviation companies are training their maintenance plateon personnel to rig. Rigging gear is being collected so if a need arises, those companies can rig their own adreraft. At this time the 611th rigging capability is baroly adequate. Group has asked that the 611th provide one more ship to the rigging section. Due to lack of float aircraft that normally are available for use as rigging ships, the 611th has not been able to provide an oxtra shin.
- (3) Might Operations: This Headquarters concurs with the recommendations and action taken.
 - c. Training:
- (1) In-country Training: This Headquarters concurs with the recommendation and action taken.

AVEAUE (14 Feb 69) 1st Ind 22 February 1969
JUBJECT: Operational Report of 7th Armored Equadron, 1st Air Cavalry for Period Ending 31 January 1969 (RCS CEPOM-65) (R1)

d. Intelligence:

POW Intelligence: This headquarters concurs with the recommendation and action taken.

- e. Logistics:
- (1) Shortage of Fromane Gas: Fromane is sumplied by commercial contractors. Coordination with Can Tho ESA has revealed an anticipated completion date for installation of commercial bulk storage and replenishment facilities at Can Tho o/a 1 March 1969. Once this is completed, the problem of transportation of propane should be minimized. In the event the commercial contractor cannot meet the requirements, the 7/1st ACS has full authorization of field mess equipment on hand.
- (2) Turn-in of Unserviceable Equipment: This headquarters concurs with the recommendation and the action taken.
- (3) Command and Control Console. AN/ASC-11: A review of requisitions submitted by 7/1st ACS revealed that the three AN/ASC-11's were only recently placed on valid requisition. Appropriate follow-up action will be taken IAM current regulations.
- (4) Support Maintenance for the MAG707 Antenna Matching Unit: This headquarters is incapable of determining if density of subject equipment is sufficient to justify a local maintenance capability or an in-country maintenance capability. Recommend a direct exchange system on items in need of repair be evaluated to determine feasibility.
 - f. Others:
- (1) ARC-54 Radios: This headquarters concurs with the recommendation and action taken.
- (2) All-16 M. Anterna: This headquarters concurs with the recommendation and action taken.
- (3) Switch. Pressure Sensing (ONGA): This headquarters concurs with the recommendation and action taken.
- (4) OHA Main Rotor Blade Dampers (FSM 1615-922-8200): This headquarters concurs with the recommendation and action taken.

20

AVBACE (14 Feb 59) 1st Ind 22 February 1969 SUBJECT: Operational Asport of 7th Armored Squadron, 1st Air Cavalry for Period Ending 31 January 1969 (RCS CSFOR-65) (A1)

(5) OE61 Recovery: This Headquarters concurs with the recommendation and action taken.

> JACK V. MACHMULL Colonel, Infantry Cormanding

DISTRIBUTION:

2 DA, ATTH: AUSFOR 1 UG, lst Avn Bde, ATTH: AVBA-U

AVBAGC-O (14 Feb 69) 2nd Ind SUBJECT: Operational Report of 7th Armored Squadron, 1st Air Cavalry for Period Ending 31 January 1969 (RCS CSFOR-65) (R1) (UIC: WiZSAA)

DA, HEADQUARTERS, 1ST AVIATION HRIGADE, APO 96384 12 MAR 1969

THRU: Commanding General, United States Army Vietnam, ATTN: AVHIC-DST APO 96375

Commander-in-Chief, United States Army Pacific, ATTN: GPOP-OT, APO 96558

TO: Assistant Chief of Staff for Force Development, Department of the Army, Washington, D.C., 20310

This headquarters has reviewed this report, considers it to be adequate and concurs with the contents, except as noted below.

a. Section I, paragraph 65, page 5: USARV Reg 614-220, Reporting and Assignment of Enlisted Personnel Returning from Overseas, dated 8 Jan 69, prescribes procedures which, if properly complied with, should substantially reduce if not eliminate the problem of non-receipt of assignment instructions for junior enlisted personnel. Normally, EM will receive assignment instructions approximately 45 days prior to DEROS. Nonreceipt of assignment instruction rosters are provided by USARV 45 days prior to DEROS month for E1-E5 personnel for updating. Personnel within 10 days of normal DEROS who are still pending assignment instructions are reidentified to USARV. USARV Reg 55-2 provides guidance to permit individuals to ship household goods prior to receipt of assignment instructions. Approximately 9% of 1st Avn Bde junior enlisted personnel receive assignments prior to ten days before DEROS. The month of December 68 unaccountably showed a slightly lower rate of approximately 96.5%.

b. Section II, paragraph Cl, page 13: All Brigade units have been directed to coordinate with division replacement training facilities located near them to obtain assistance in replacement training. These training units have facilities available to accomplish all replacement training requirements and have given excellent cooperation to 1st Aviation Brigade units. The 9th Infantry Division is nearest to the 7/1st AGS Base Camp and can assist them in their replacement training.

c. Section II, paragraph 24, page 15: Reference USARV confidential message, 86623, dated 31 December 1968 which outlines the basis of issue of ASC 10, 11, and 15's. Command consoles are issued to aviation groups or separate battalions only. They are command-controlled items and will only be received through a BOI. The 7/1st ACS must coordinate their mission requirements with the 164th Group for an increase in allocation of 164th Group's resources.

AVGAGC-0 (14 Feb 69) 2nd Ind SUBJECT: Operational Report of 7th Armored Squadron, 1st Air Cavalry for Period Ending 31 January 1969 (RCS CSFOR-65) (R1) (UIC: WGZ6AA)

- d. Section II, paragraph E5, page 15: Units who have MX 6707 matching units which have been in the repair and return to user program over eix weeks should receive a turn-in and requisition new ones on a one-for-one basis. Goordination is being made with 1st Log to have the MX 6707 placed into a repair and return to etock program. Antenna matching unit MX 2799/VRC, the predecessor to the MX 6707, is a good substitute item and ie in the supply system.
- e. Section II, paragraph Fl, page 16: The problem existing in AH-1G aircraft with ARG-54 radios is a heat problem. The location of the radio allows very little air circulation and receives heat from the engine exhaust. Tests are being conducted to measure heat in the vicinity of the ARG-54 in the AH-1G. Different modifications have been performed locally, one of which appears to relieve the heat problem. Avionics Labs and EGCM personnel, in conjunction with the Avionice officer of 1st Aviation Brigade and 3/17th AGS, are conducting these tests to achieve an MWO which will eliminate the transmission problems of the ARG-54 in the AH-1G aircraft.

FOR THE COMMANDER:

DAVID R. ANDERSON

CIT, AGC

AVHGC-DST (14 Feb 69) 3d Ind SUBJECT: Operational Report of 7th Armored Squadron, 1st Air Cavalry for Period Ending 3l January 1969 (RCS CSFOR-65) (R1) (U)

HEADQUARTERS, UNITED STATES ARMY, VIETNAM, APO San Francisco 96375 2 4 MAR 1969

TO: Commander in Chief, United States Army, Pacific, ATTH: GPOP-DT, APO 96558

This headquarters has reviewed the Operational Report-Lessons Learned for the quarterly period ending 31 January 1969 from Headquarters, 7th Armored Squadron, 1st Air Cavalry and concurs with report and the indorsements of intermediate headquarters.

FOR THE COMMANDER:

C. D. WILSON

1LT, AGC

Assistant Adjutant General

Cy furn: 7/1st ACS lst Avn Bde

GPOP-DT (14 Feb 69) 4th Ind (U) SUBJECT: Operational Report of HQ, 7th Armored Sedra, let Air Cav for Period Ending 31 January 1969, RCS CSFOR-65 (R1)

MQ, US Army, Pecific, APO Sen Frencisco 96558 1 APR 1969

TO: Assistant Chief of Steff for Force Development, Department of the Army, Washington, D. C. 20310

This heedquarters has evaluated subject report and forwarding indorsements and concurs in the report as indorsed.

FOR THE COMMANDER IN CHIEF:


G. E. HOLEFIELD MAJ, AGC Asst AG

INCLOSURE 1 (AFTER ACTION REPORT) to Operational Report Lessons Learned for Quarterly Period Ending 31 January 1969

In November 1968, Troop D provided security for a fire support base in the vicinity (VS89358) while OPCON to the 44th ST2. During this operation the VC held fortified positions along the SW portion of Nui Coto (VS900562). Troop D planned their 106RR on air boats supplied by th 44th STZ to enable the weapons to move down into the open swamp land where direct fire could be placed in the VC caves. The air boat was very effective as a maneuver element, however, the air boat could not maintain its normal speed. Due to the weight of the 106RR only 4 rounds could be carried in the same boat. This caused a problem in that the additional air boats carried the ammunition for the weapons, and rounds had to be transferred from one air boat to the other. When fired, the 106RR had very little effect on the boat, however, a great deal of water and spray covered the area. The stability and accuracy of the 106RR were not affected. this adaptation allowed the 106RR to be carried over terrain where normally a heavy crew served weapon could not be used (See Incl 1 to Incl 1). During the same operation the 106RR was placed on top of an armored personnel carrier to accomplish the same mission. adaptation also proved to be very satisfactory in that the APC could traverse the open swampland and rice paddies with little or no problem. The APC with the 106RR was able to carry the basic load of ammunition required (See Incl 2 to Incl 1). Both of these concepts have proven very valuable and have been used frequently by Troop D, 7/1 AOS on operations in the IV CTZ.

> 26 Confidential

INCLOSURE 1 TO INCLOSURE 1 (AFTER ACITON REPORT) to Operational Report Lessons learned for Quarterly Period Ending 31 January 1969

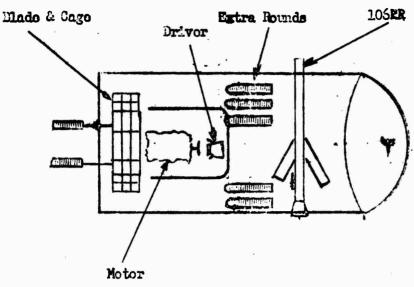


Directional Flaps

Mount for 50 cal or 30 cal MG


AIR CAT

106RR Mounted on Air Boat

27 Confidential MICLOSURE 2 TO INCLOSURE 1 (AFTER ACTION REPORT) to Operational Report Lessons Learned for Quarterly Period Ending 31 January 1969

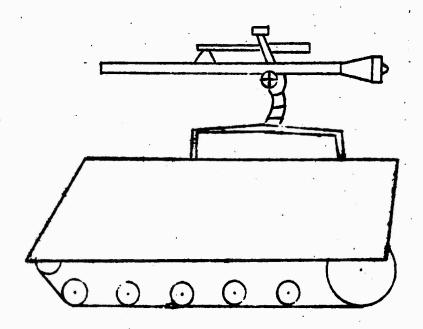

106DR Mounted on APC

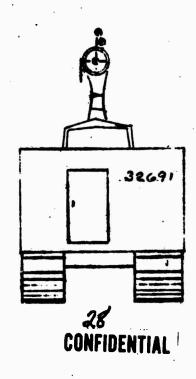

INCLOSURE 2 (AFTER ACTION REPORT) to Operational Report Lessons Learned for Quarterly Period Ending 31 January 1969

On 31 December 1968, B Troop, 7th Squadron, 1st Air Cavalry received a mission to VR an operations area NW of Ca Mau (VR953490) in support of the 21st ARVN Division Operations.

While conducting a visual recommaissance of the area B Troop located numerous sampans traveling SW along a network of canals, loaded with equipment and ammunition. The sampans were not camouflaged or hidden but were left along the canals as if the personnel traveling in them had departed in a hurry as the aircraft approached. B Troop inserted troops on the various clusters of sampans.

As the teams and C&C aircraft orbited overhead, the Troop Commander observed what appeared to be a VC several hundred motors away. He was in tall grass and reeds waving a white cloth. It was surmised that this individual was possibly bait for a trap, however, the possibility of a defection or surrender could not be overlooked. The Troop Commander requested that his scout aircraft cover him while he approached the man to attempt a pick up. On landing in the area, he noticed that the man had a fair complexion and long bourd, definitely not a Vietnamese, As the Troop Commander departed the area he notified the 21st ARWN Day, that he had just picked up James N. Rowe, an American officer who had been held prisoner by the VC for 5 years. The expression and relief displayed on Rowe's face after being picked up was enough to convince the men of B Troop that their year in Vietnam would be a memorable one and that 31 December 1968, would be a New Year's Eve never forgotten. The Troop dropped Inj. Rowe off at Ca Man to a reception committee of numerous personnel for examination and questioning and returned to the operational area, An insertion was made in the same vicinity where numerous caches of amunition and equipment were secured. In one back pack, several pictures were found showing numerous Americans being examined by WC doctors. Maj. Nowe was included in some of these pictures. The contents, along with caches were turned over to the 21st ARWN Division.

29

INCLOSURE 3 (AFTER ACTION REPORT) to Operational Report Lessons Learned for Quarterly Period Ending 31 January 1969

On 4 January 1969, Troop B, 7th Squadron, 1st Air Cavalry received a mission to VR an operational area SW of Vi Thanh (WR190680) in support of a 21st ARVN Division operation.

While conducting a visual reconnaissance of their assigned area, 4 armed men were observed running toward a tree line. After receiving clearence to fire, the gun team rolled in to suppress the area with rockets and mini gums. Upon completion of the firing runs the scout aircraft returned to check the damage. As they approached the area, they received heavy automatic weapons fire. The lead CH-6A crashed out of control against a tree line and burst into flames on impact. The observer was dead inside the flaming wreckage, however, the pilot managed to crawl clear. The scout wingman attempted to land by the burning helicopter but the enemy's automatic weapons fire severely wounded him. He was shot in the leg, had one finger shot off and was temporarily blinded by skettaming plexiglass. His scout observer took control and landed the aircraft approximately 1000 meters away from the action. The weapons platoon leader in the lead Cobra spotted the pilot of the first LOH crauling away from the fire. He immediately landed his Cobra to pick him up. The pilot of the Cobra dismounted and went to the IOH pilots aid, as his wingman began making gum runs on the closing VC. Hith this covering fire, the Weapons Platoon Leader and his pilot were able to get the scout pilot onto the armo bey door and fly clear of the contested area. As soon as this rescue was completed the Cobra wingman located the second LOH and landed to evacuate the crew. In this case, the Cobra pilot got out of his helicopter to holp the soout observer carry the seriously wounded scout pilot to the Cobra. Once they had placed the wounded pilot on the ammo bey door, the second scout observer got in the front seat of the Cobra and the Cobra pilot used his own body as a shield to hold the wounded officer on proved the value of the Cobra in roles other than that of a wapons platform, while also exemplifying the initiative and ingenuity of the Dutchmaster Team.

> *多*と Confidential

DD . FORM . 1473

DOCUMENT CON (Security electification of title, body of abetract and indexis	TROL DATA - R		amenii senest la alaugilla da
I. DRIBINATING ACTIVITY (Corporate author)		24. REPORT SE	CURITY CLASSIFICATION DENTIAL
HQ, OACSFOR, DA, Washington, D.C. 20310		25. GROUP	4
Operational Report - Lessons Learn Cavalry, Period Ending 31 January	ed, Hq, 7th A 1969 (U)	rmored Squ	adron, 1st Air
4. DESCRIPTIVE NOTES (Type of report and inclusive detect) Experiences of unit engaged in countering 5. AUTHOR(B) (First news, middle initial, lest news) CO, 7th Armored Squadrun, 1st Air		ations, 1 N	ov 68 - 31 Jan 69
i. REPORT DATE	78. TOTAL NO. O	PAGES	76. NO. OF REFS
14 Feb 69	34		L
&. CONTRACT OR GRANT NO. &. PROJECT ND.	691178	# REPORT NUM!	SC R(3)
c. N/A	95. OTHER REPO	RT NO(S) (Any o	ther numbers that may be assigned
IO. GISTRIBUTION STATEMENT			· · · · · · · · · · · · · · · · · · ·
11. SUPPLEMENTARY NOTES	12. SPONSORING	MILITARY ACTI	VITY
N/A	OACSFOR, DA	A, Washing	ton, D.C. 20310
13. ABSTRACT			
			.•
•		•	
,	•		•
·			
•	ı	•	
			,
31/			•

UNCLASSIFIED

Security Classification